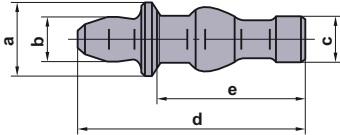
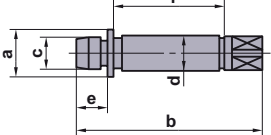
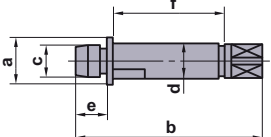
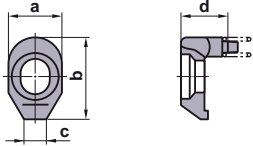
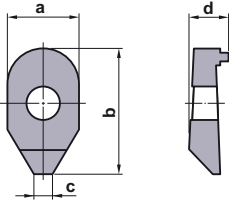
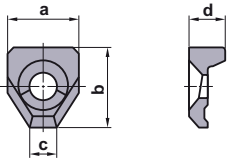
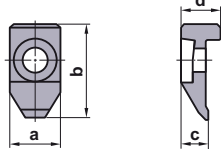
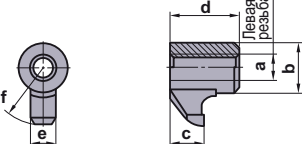


ЗАПИРАЮЩИЙ ШТИФТ

Геометрия	Обозначение	Размеры (мм)						Державка
		a	b	c	d	e	f	
	P11S	6	3.7	4	17	11.1	—	Державка MP типа (☉C019—C021) D Тип Расточных головок (☉E044, F134, G036)
	21S	7.5	4.9	4.5	17.2	11.5	—	
	P221US	4	18	2.11	3.5	3.3	7.7	
	321US	5.5	18	3.64	5.0	3.3	7.5	
	322US	5.5	21	3.64	5.0	3.3	10.5	
	323US	5.5	24	3.64	5.0	3.3	13.5	
	332US	5.5	21	3.64	5.0	4.9	8.9	
	P323WS	5.8	24	3.64	5.0	3.3	12.9	
	333WS	5.8	24	3.64	5.0	4.9	11.3	
	334WS	5.8	30	3.64	5.0	4.9	17.3	
	433W	7.8	24	5.03	7.0	4.9	10.8	
	434W	7.8	30	5.03	7.0	4.9	16.8	

ПРИХВАТ

Геометрия	Обозначение	Размеры (мм)						Державка
		a	b	c	d	e	f	
	AMS3	7	12	3	3.3	—	—	Тип фрезы AJX (☉K070)
	4	9	13.5	3	3.8	—	—	
	5	10	15	3.5	5	—	—	
	CA142	8	15	4	7	—	—	
	150	9	16	4.5	7	—	—	
	151	10	17	5	7	—	—	
	152	10	19	5	7	—	—	
	153	10	24	5	7	—	—	
	161	13	20	6	8	—	—	
	162	13	24	6	8	—	—	
	163	13	27	6	8	—	—	
	ССК13	15	18.5	6	9	—	—	Державка WP типа (☉C016—C018, C023) M Тип расточного инструмента (☉E040)
	14	19	22	8	9.5	—	—	
	ССТС1	13	25	7	10.2	—	—	
	СК231	M6×1	8	4	7.5	4.5	9.5	
	232	M6×1	8	4.5	8	4.5	11.5	
	341	M8×1	11	5.5	13.5	6	13.5	
	342	M8×1	11	6	14	6	16.5	